


Injector-Rehab.com

Injector p/n 4106	Vehicle Civic Si		Joe Example					
	Year 1993							
	Engine		1/1/2001					
	Injector #							
Test	1	2	3	4	5	6	7	8
Resistance ohms	11.9	11.9	11.8	11.9				
Leak Test Before	Pass	Pass	Pass	Pass				
Pass / Fail After	Pass	Pass	Pass	Pass				
Spray Pattern Before	Good	Good	Poor	Good				
Spray Pattern After	Good	Good	Good	Good				
Static Flow Before	282	279	243	276				
Static Flow After	279	276	274	276				
15 sec @ 3 Bar	69.75	69	68.5	69				
cc/min @ 3 Bar	279	276	274	276				

EXAMPLE

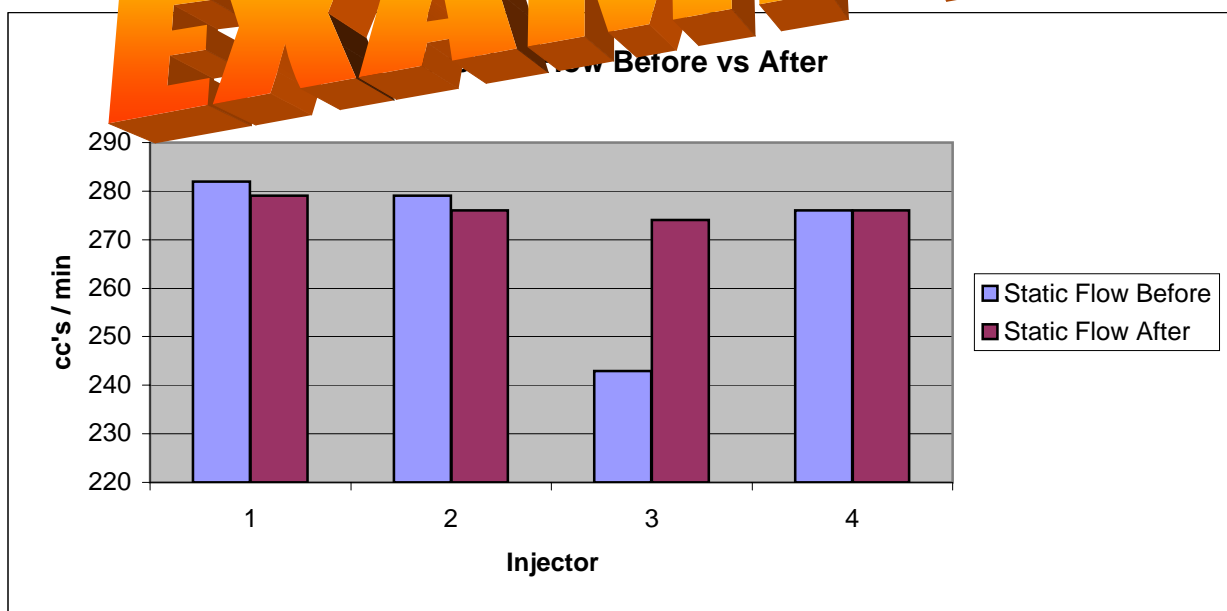

Largest Variance Before 13.830%
 Largest Variance After 1.792%

* Any percent variance under 2% is ideal.